



CYCLONE TESTING STATION

SUPPLEMENTARY REPORT


ON


STRUCTURAL DAMAGE CAUSED BY CYLCONE 'KATHY'

AT BORROLOOLA, N.T., MARCH 1984

G.N. Boughton

SUPPLEMENTARY REPORT

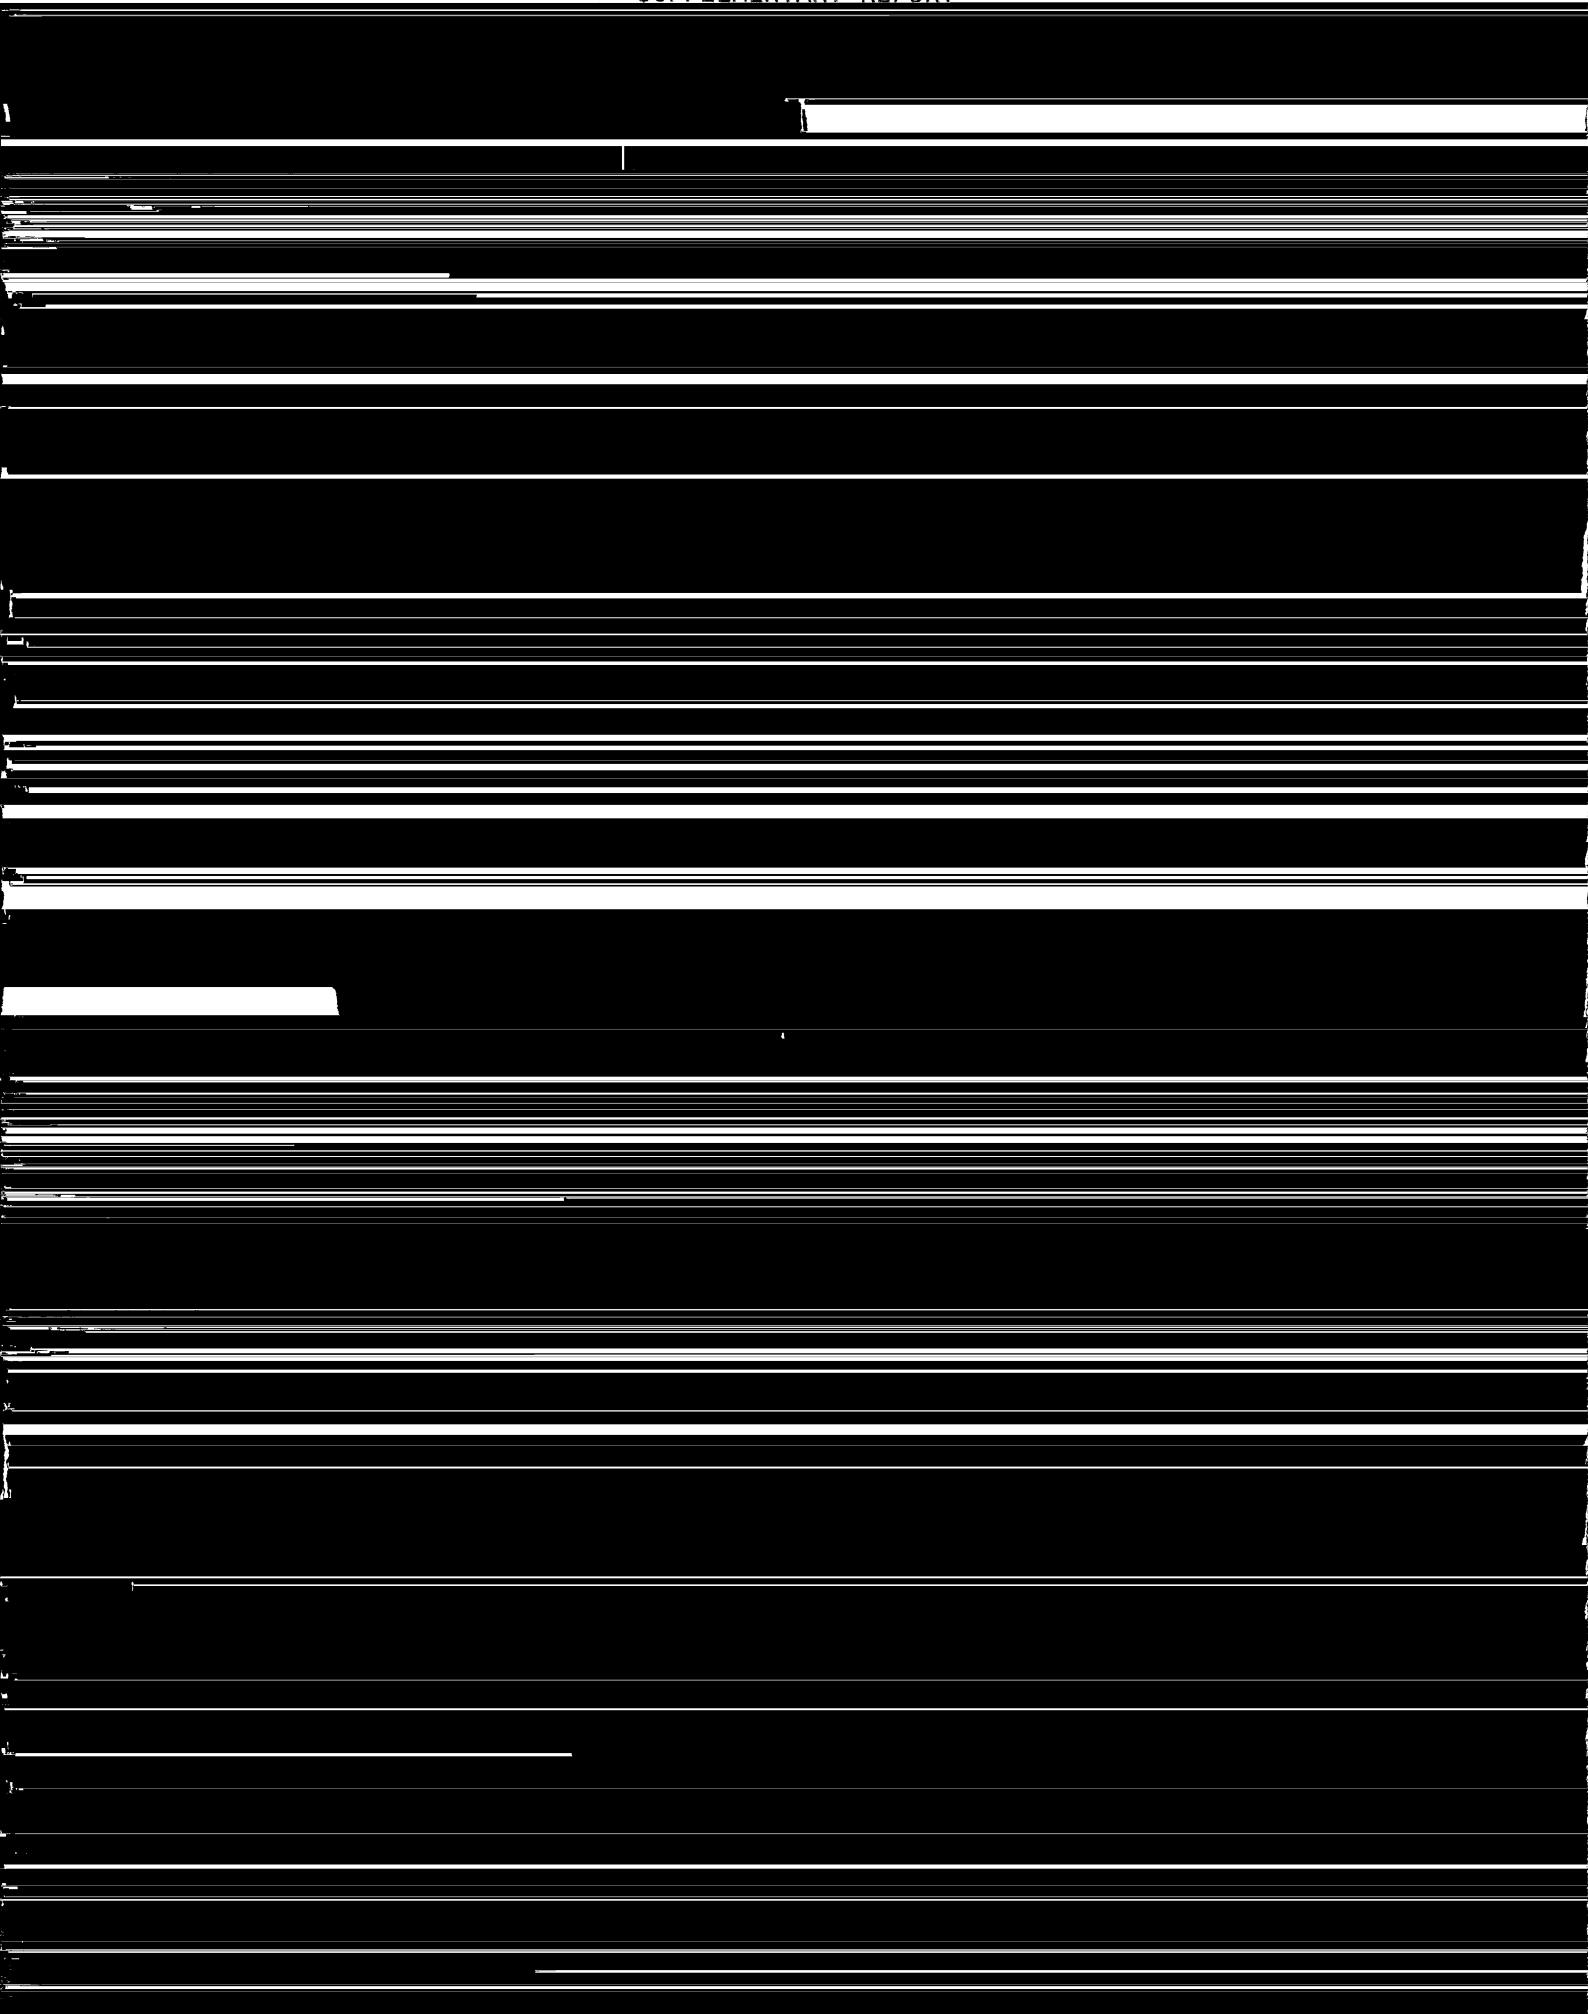

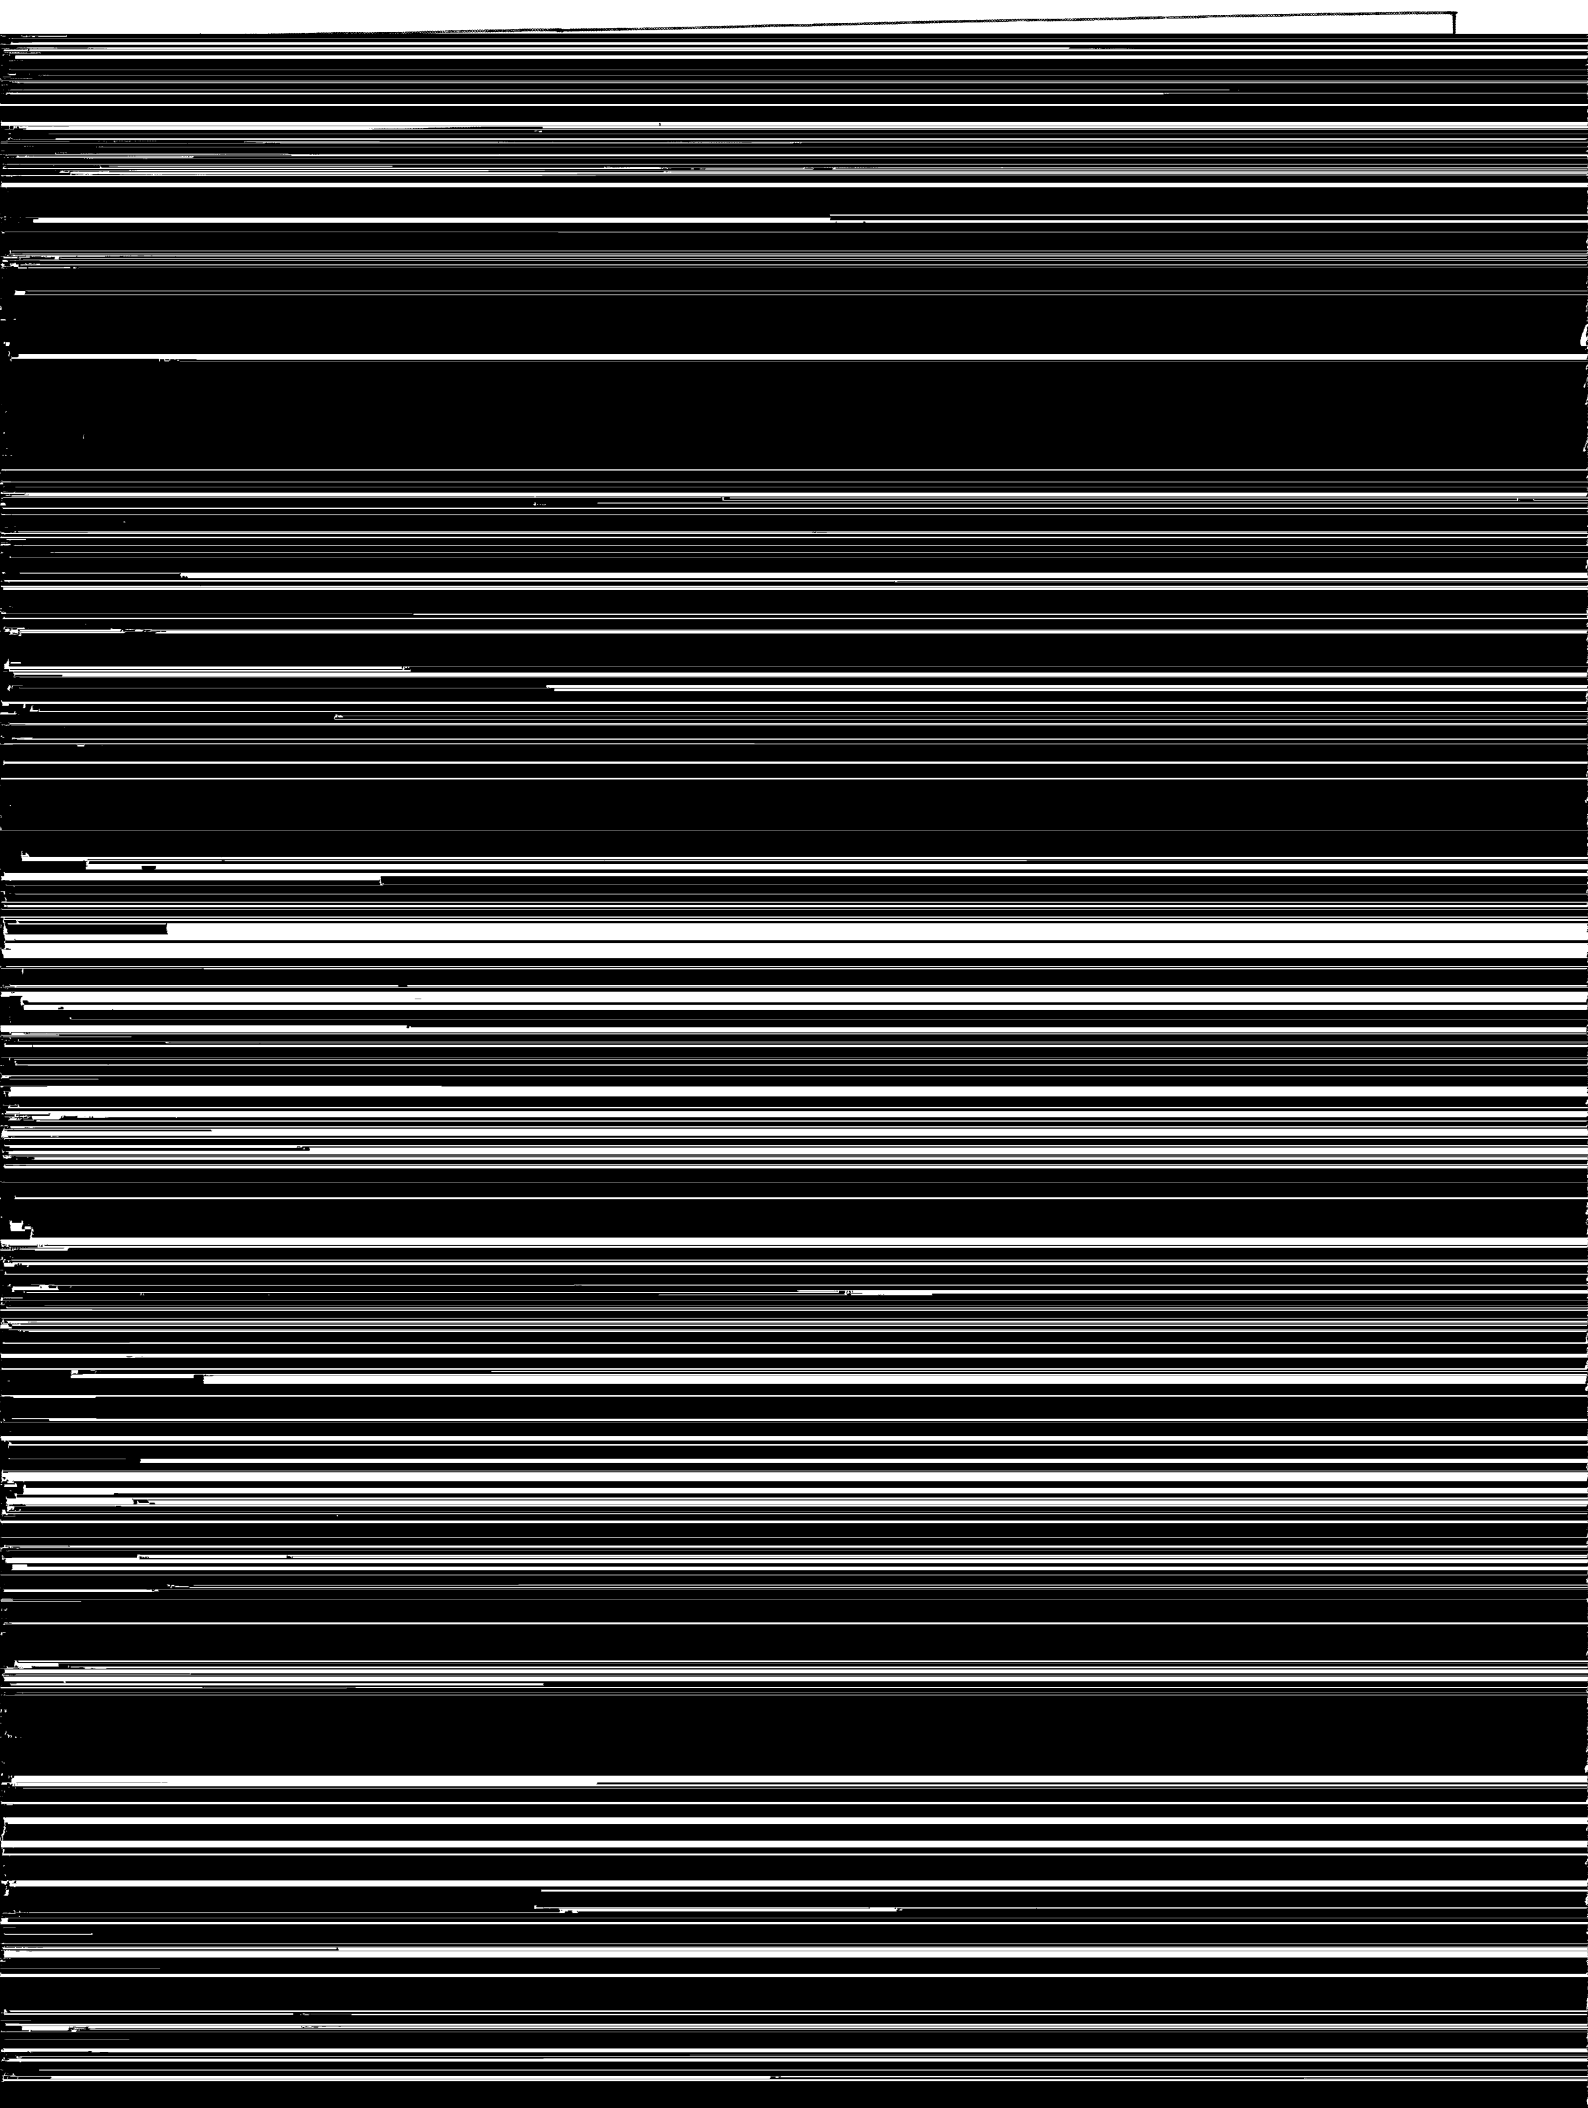

5. POLICE STATION COMPLEX

This complex consisted of two houses, an office building, cell block and

of the main report. The roof sheeting with battens attached was removed

from a portion of the roof that was supported on trusses. The batten to truss

connection proved quite inadequate to resist the uplift forces it attracted.

Met. 7. The design for CC lining used to secure battens, but current design

7.3 Adult Education Centre

and the television repeater performed well and Telecom is involved

REFERENCES

DOUGHTON, C. N. and DEARDON, C. F. (1984) *Structure and Dynamics of the*